

This valve is a spring biased closed, pilot-to-close check cartridge with a bypass orifice. It incorporates a steel seat and is non-vented. The valve allows flow from port 1 to port 2 and restricts flow from port 2 to port 1. Pressure at the pilot (port 3) opposes pressure at port 1 at a ratio of 1.8:1. Pressure at port 2 directly opposes the pilot pressure. Note: The bypass orifice diameter is specified by the customer. See Technical Data below for the allowable orifice range.

TECHNICAL DATA NOTE: DATA MAY VARY BY CONFIGURATION. SEE CONFIGURATION SECTION.

Cavity	T-11A
Series	1
Capacity	20 gpm
Maximum Operating Pressure	5000 psi
Pilot Ratio	1.8:1
Orifice Range	.016 - .107 in.
Valve Hex Size	7/8 in.
Valve Installation Torque	30 - 35 lbf ft
Seal kit - Cartridge	Buna: 990-011-007
Seal kit - Cartridge	Polyurethane: 990-011-002
Seal kit - Cartridge	Viton: 990-011-006


OPTION SELECTION EXAMPLE: CNDEXCNV

CONTROL	(X) SETTING RANGE	(C) SEAL MATERIAL	(N)
X Not Adjustable	C 30 psi (2 bar) Cracking Pressure, .016 - .107 in. (0,4 - 2,7 mm) A 4 psi (0,3 bar) Cracking Pressure, .016 - .107 in. (0,4 - 2,7 mm) B 15 psi (1 bar) Cracking Pressure, .016 - .107 in. (0,4 - 2,7 mm) D 50 psi (3,5 bar) Cracking Pressure, .016 - .107 in. (0,4 - 2,7 mm) E 75 psi (5 bar) Cracking Pressure, .016 - .107 in. (0,4 - 2,7 mm) F 100 psi (7 bar) Cracking Pressure, .016 - .107 in. (0,4 - 2,7 mm)	N Buna-N V Viton	

TECHNICAL FEATURES

- Features hardened steel seats for excellent wear characteristics and contamination tolerance.
- Nominal pilot ratio is 1.8:1. This means that a pressure of 1000 psi (70 bar) at the pilot port will close a valve against a pressure of 1800 psi (125 bar) at port 1. Any decay or loss of pilot pressure could allow the valve to open, even if it is a momentary decay or loss.
- Pressure at the port 2 area directly opposes pilot pressure.
- With equal pressures at all ports the valve is closed.
- Incorporates the Sun floating style construction to minimize the possibility of internal parts binding due to excessive installation torque and/or cavity/cartridge machining variations.

PERFORMANCE CURVES

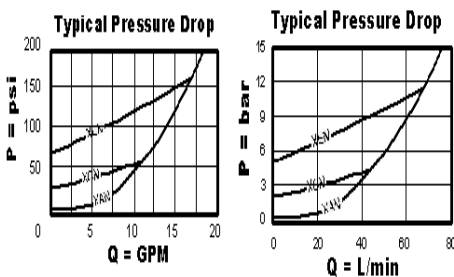

Performance data shown reflects a blocked orifice.